




Extremely Small Size Enables Space Saving and Quick Installation!



Extremely Small


Ultra-small type **PM-** \Box **24(-R**) contributes to the miniaturization of your equipment. Even the small cable type has become very compact.

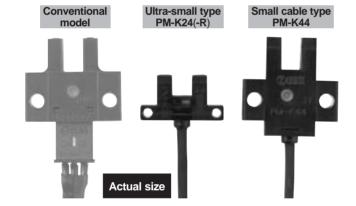

Equipped with Two Independent Outputs


All models are equipped with two independent outputs – Light-ON and Dark-ON. Hence, one model suffices even if the output is to be used differently, depending upon the location of use.

Also, since two independent outputs have been provided, cumbersome handling of the output conversion control input, or fear of logic inversion due to a cable break, is eliminated. The sensor can be connected to the existing wiring as it is.

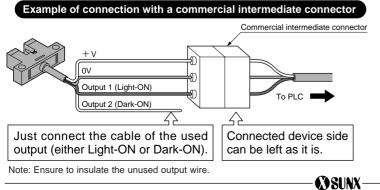

Quick Fitting Hook-up Connector

Easy to maintain connector type models are available. Its exclusive connector is the industry's first hook-up connector. Since only crimping with exclusive pliers is to be done, cumbersome soldering or insulation is absolutely not required. Further, connector attached cable is also available.



Crimp the connector on the cable.

Quick connection to the sensor.

Wide Model Variety

A wide variety of 17 shapes and 29 models is available. You may select from this wide range to suit the mounting conditions.

Meets Global Requirements

Conforms to Europe's EMC Directive. Both, NPN and PNP output models are available.

MS-AJ Sensor Mounting Stand

PM

Sensor Mounting Stand MS-AJ

PΖ

PM2

Micro

APPLICATIONS

Sensing the starting point on a rotating body


The starting point can be sensed by making a slit in the rotating body.

Determining the pallet position

Pallet is stopped by sensing the dog.

Sensing the starting point and overrun of a moving body

Starting point and overrun is sensed using the dog on the base.

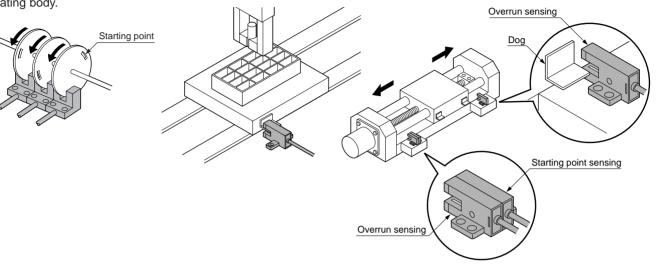

ORDER GUIDE

ORDER GUIDE							Tvno	NX5
Ту	ре	Appearance (mm)	Sensing range	Model No. (Note)	Output	Output operation		
	'pe			РМ-К24			Multi-voltade	VF
	K type	22 12 6		PM-K24-R	NPN open-collector transistor	Incorporated with 2 outputs: Light-ON/Dark-ON	Σ	
	L type	13.4 10.5	5mm (fixed) PM-F24 9M-F24-R PM-F24-R PM-R24 PM-R24	PM-L24			Tvno	SH SH
	L t)			PM-L24-R			Amnlifier-cenarated Tvne	SU-7/SH
Ultra-small	F type	10.5 13.4 12		PM-F24			r-sens	2000
Ultra	Ε			PM-F24-R			mnlifia	SS-A5
	R type	10.5 13.4 13.4		PM-R24				·
	Ř			PM-R24-R				CHX-SC2
	U type			PM-U24				CH
	Ut	13.4		PM-U24-R				

Note: The suffix '-R' indicates a inflection resistant cable type.

ORDER GUIDE

PM

US-AJ

Ρ

PM2

NX5

۲F

HS/2-US

SS-A5

CHX-SC2

E E													
PHOIOEL	Т	Туре	•	Appearance (mm)	Sensing range	Model No.	Output	Output operation					
AJ ing Stand			K type			РМ-К44	NPN open-collector transistor						
Sensor Mounting Stand			K ty	25.4 26.2		PM-K44P	PNP open-collector transistor						
Ser			T type	13.7		PM-T44	NPN open-collector transistor						
ž			Τty	26.2		PM-T44P	PNP open-collector transistor						
Micro			type	26 18.5		PM-L44	NPN open-collector transistor	-					
		With cable	L ty			PM-L44P	PNP open-collector transistor						
		With	Y type	15.5 (a)		PM-Y44	NPN open-collector transistor						
0			Y ti	25.5		PM-Y44P	PNP open-collector transistor						
VF NA3 Multi-voltage Type			F type	132		PM-F44	NPN open-collector transistor						
voltag			Ш. Ц	26.2		PM-F44P	PNP open-collector transistor						
Vr Multi-			R type			PM-R44	NPN open-collector transistor						
	Small		Ŗ	26.2	5mm (fixed)	PM-R44P	PNP open-collector transistor	Incorporated with 2 outputs:					
-separated Type	Sr		K type			РМ-К54	NPN open-collector transistor	Light-ON/Dark-ON					
ou- Darate			¥	25.4 22.2			PNP open-collector transistor						
-AJ ifier-sep			T type	13.7			NPN open-collector transistor						
Amplifier		onnector	μ.	26 22.2		PM-T54P	PNP open-collector transistor						
			onnector	onnector	onnector	onnector	onnector	onnector	L type	PM-L54	PM-L54	NPN open-collector transistor	
Sensor Checker									onnector	onnector	onnector	With connector	ــــ
Sens		With c	Y type	15.5		PM-Y54	NPN open-collector transistor						
			>	13.4 21.5		PM-Y54P	PNP open-collector transistor						
			type	13.2		PM-F54	NPN open-collector transistor						
			Ē	13.7		PM-F54P	PNP open-collector transistor						
			R type			PM-R54	NPN open-collector transistor						
			R	13.7		PM-R54P	PNP open-collector transistor						

SUNX-


OPTIONS

Designation Model No.		Description			
Connector	CN-14	Connector for soldering			
Hook-up	CN-14H	This connector can be hooked-up on 0.0 0.2mm ² cable simply in one grip. Wire diameter: \$0.7 to \$1.2mm			
connector	CN-14H-2	Suitable for UL standard cable. This connector can be hooked-up on 0.18 0.22mm ² cable simply in one grip. Wire diameter: ϕ 1.2 to ϕ 1.52mm			
Connector	CN-14H-C1		For the connector type, with 0.18mm ² 4-core cabtyre cable		
attached cable	CN-14H-C3	Length: 3m	Cable diameter: ϕ 3.8mm		
Hook-up pliers	CN-HP	These are exclusive pliers for hool connectors CN-14H and CN-14H-2.			
Mounting screw	MS-M2	Mounting screw with washers for the u small type sensor (50 Nos. lot). It can m securely as it is spring washer attached.			

 Connector
 Hook-up connector

 Image: Connector attached cable
 Hook-up pliers

00000



Mounting screw

Common Common

 Sensor Checker
 Amplifier-separated Type
 Multi-voltage Type
 Micro

 CHX-SC2
 SS-A5
 SU-7/SH
 VF
 NX5
 PM2


ΡZ

SPECIFICATIONS

PM


РНОТОЕ		\bigwedge			Ultra-small			nall			
H		\setminus		Туре		With inflection resistant cable	With cable	With connector			
	and		Model	NPN output type	PM24	PM-□24-R	PM-□44	PM54			
US-AJ	ing St	Iter	\ No	PNP output type			PM-□44P	PM-[]54P			
	lount	Ser	sing range		5mm (fixed)						
Σ	Sensor Mounting Stand	Min	imum sensi	ng object	0.8×1.8mm opaque object						
	Se	Hys	teresis		0.05mm or less						
		Rep	peatability		0.03mm or less						
Σd		Sup	oply voltage		5 to 24V DC \pm 10% Ripple P-P 10% or less						
<u>u</u>		Cur	rent consur	nption		15mA (or less				
	Micro	Output			<npn output="" type=""> PNP output type> PNP open-collector transistor • Maximum sink current: 50mA • Applied voltage: 0.7V or less (at 50mA sink current) • Residual voltage: 0.7V or le</npn>						
PM2			·			• Residual voltage: 0.7 v or less (at 50mA source current) 0.4V or less (at 16mA sink current) 0.4V or less (at 16mA source current)					
			Utilization	category		DC-12	or DC-13				
			Output ope	eration		Incorporated with 2 out	tputs: Light-ON/Dark-ON				
NX5	be	Response time			Under light received condition: 20 µs or less Under light interrupted condition: 100 µs or less (Response frequency: 1kHz or more)(Note 1)						
î		Operation indicator			Vermilion LED (lights up under light received condition)						
	age		Pollution d	egree		3 (Industrial e	environment)				
	Multi-voltage	e	Ambient tem	perature (Note 2, 3)	-25 to $+55^{\circ}$ C (No dew condensation or icing allowed), Storage: -30 to $+80^{\circ}$ C						
	, Š	resistance	Ambient h	umidity	35 to 85% RH, Storage: 35 to 85% RH						
۲ ۲	Iul	resi	Ambient ill	uminance	Fluorescent light: 1,000 ℓ x at the light-receiving face						
	2	Environmental	EMC								
		onm	Voltage withstandability		1,000V AC for one min. between all supply terminals connected together and enclosure						
Ŧ	be	Envir	Insulation	resistance	50MΩ, or more	ether and enclosure					
/SH	Þ	Σ Π		Vibration resistance 10 to 2,000Hz frequency, 1.5mm amplitude in X, Y and Z directions for two hou						hours each	
HS/7-US	ted		Shock resi	stance	15,000m/s ² acceleration (1,500G approx.) in X, Y and Z directions for three times each						
S	ara	Emitting element			Infrared LED (non-modulated)						
	e p	Material			Enclosure: PBT, Slit cover: Polycarbonate, Terminal part [PM-[54(P) only]: Solder plated						
A 5	ier-s	Cat	ble		0.09mm ² 4-core cabtyre cable (PM-[24-R: 0.1mm ² inflection, oil and heat resistant cabtyre cable), 1m long						
SS-A5	plif	Cable extension			Extension up to total 100m is possible with 0.3mm ² , or more, cable.						
0)	Amplifie	We	ight		10)g approx.	15g approx.	3g approx.			
		Note	es: 1) The re	esponse frequenc	y is the value when the disc	c, given in the figure below, is rotated	1.				
CHX-SC2	Sensor Checker		<u> </u>		Disc	Disc 1.8mm					
						t = 0.2mi	m				





2) In case the ultra-small type **PM**- \Box **24**(-**R**) is used at an ambient temperature of $+50^{\circ}$ C, or more, make sure to mount it on a metal body. 3) Take care that the flexibility of the **PM**- \Box **24**-**R** cable is lost if the ambient temperature in near -10° C.

I/O CIRCUIT AND WIRING DIAGRAMS

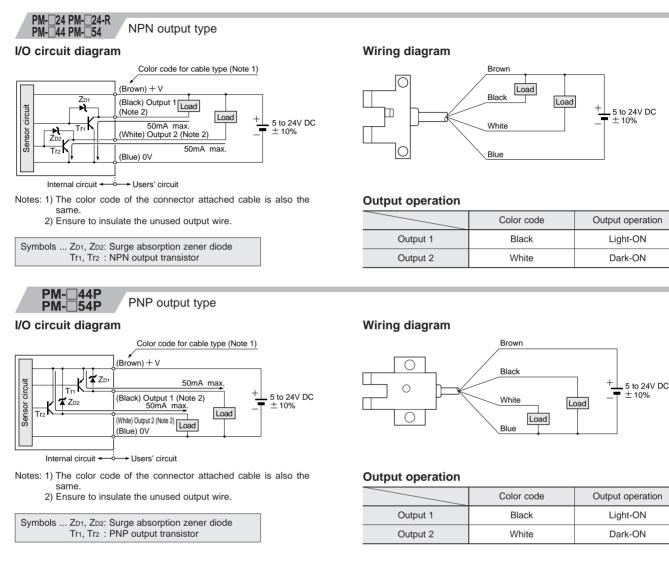

PRECAUTIONS FOR PROPER USE

All models



This product is not a safety sensor. Its use is not intended or designed to protect life and prevent body injury or property damage from dangerous parts of machinery. It is a normal object detection sensor.

Wiring

 Please carry out the wiring carefully since protection circuits against reverse power supply connection and output short-circuit are not incorporated.

Others

• Since the sensor is intended for use inside machines, no special countermeasures have been taken against extraneous light. Take care that extraneous light is not directly incident on the beam receiving section.



Refer to P.820~ for general precautions.

- Do not use during the initial transient time (50ms) after the power supply is switched on.
- The cable of **PM-**24-**R** is a flexible cable usable on a moving base. When the sensor is mounted on a moving base, fix the sensor cable joint so that stress is not applied to it.
- Take care that the flexibility of the **PM-** \Box **24-R** cable is lost if the ambient temperature is near -10° C.

Sensor Mounting Stand

MS-AJ

M

PM2

NX5 Type

Ч

HS/2-US

SS-A5

Multi-voltage


Amplifier-separated Type

CHX-SC2 Sensor Checker

All models

Mounting


PM



PM-□24(-R) is used at an ambient temperature of + 50°C, or more, make sure to mount it on a metal body.

Cable extension


 Cable extension is possible up to an overall length of 100m with a 0.3mm², or more, cable. However, since a voltage drop shall occur due to the cable extension, ensure that the power supply voltage at the end of the cable attached to the sensor or at the sensor terminals is within the rating.



But, when the overall cable length, including the cable attached to the sensor, is as given below, there is no need to confirm the voltage.

Conductor cross-section area	Total cable length			
0.08 to 0.1mm ²	Up to 5m			
0.2mm ²	Up to 10m			
0.3mm ²	Up to 20m			

DIMENSIONS (Unit: mm)

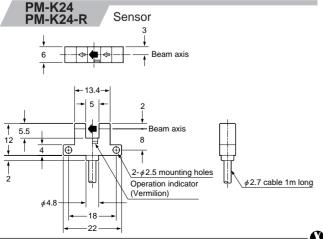


Wire diameter

Conductor cross-section area


PM-**⊡**54 PM-⊡54P


Crimping of hook-up connectors CN-14H and CN-14H-2

Item Model No.	CN-14H	CN-14H-2		
Conductor cross- section area	0.08 to 0.2mm ² (AWG28 to AWG24)	0.18 to 0.22mm ² (AWG25 to AWG24)		
Wire diameter	¢0.7 to ¢1.2mm	¢1.2 to ¢1.52mm		
Wire insulation material	Vinyl chloride ethylene	or soft poly-		



① Strip the cable sheath 15mm, or more, and insert the wires into the connector insertion holes till the wire tips reach the end.






② Crimp with the exclusive hook-up pliers CN-HP.


Caution: Make sure to use the exclusive hook-up pliers **CN-HP**. Commercially available pliers cannot be used.

Soldering


• If soldering is done directly on the terminals, strictly adhere to the conditions given below.

Item Model No.	PM-□54(P)		l	L	1
Soldering temperature	260°C or less	$\left \right\rangle$		\bigcirc	1.5mm
Soldering time	3 sec. or less		+ V 1 2 0V		
Soldering position	Refer to the right figure		िन्निन्न	Solder	ring position 🕇

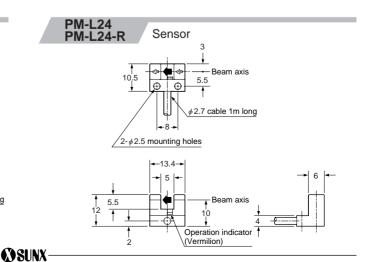

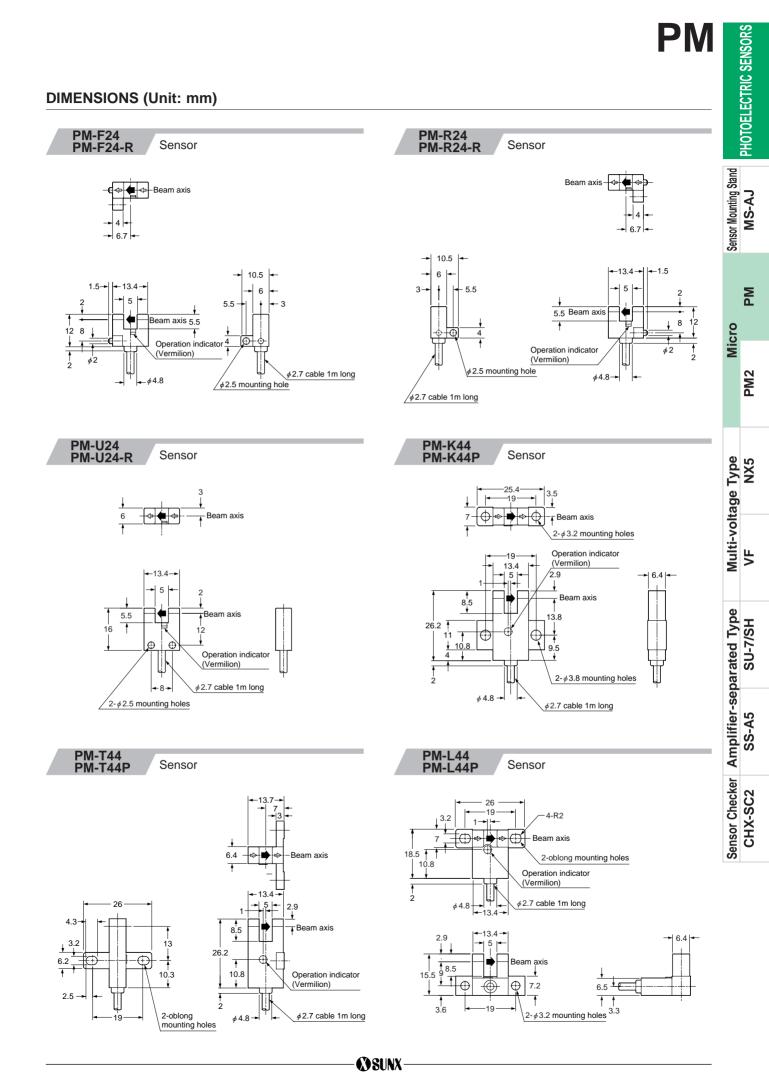


DIMENSIONS (Unit: mm)

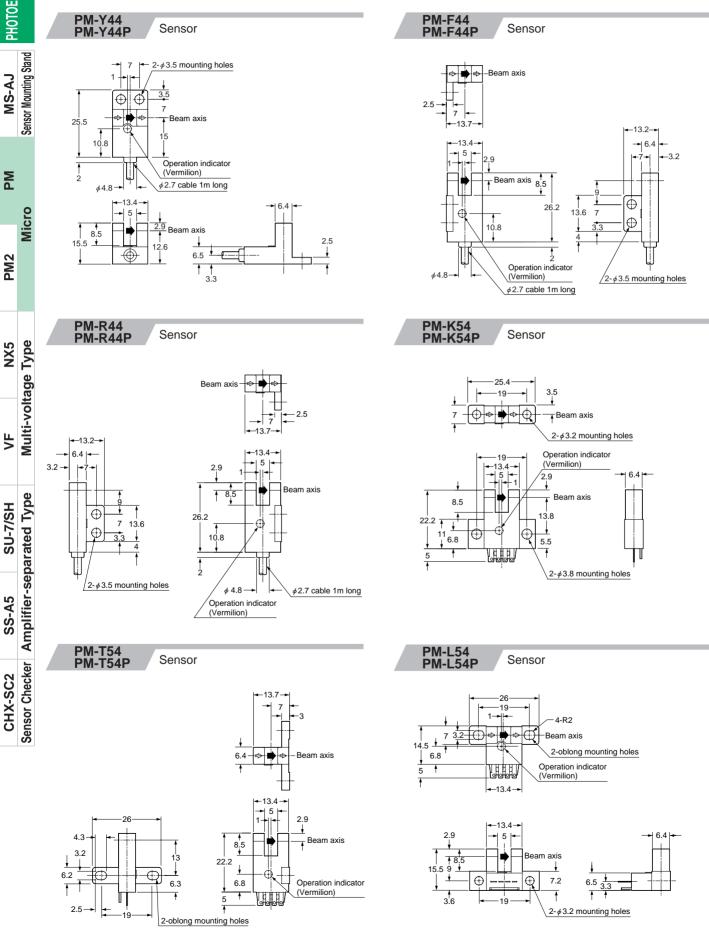

SUNX

PM

DIMENSIONS (Unit: mm)

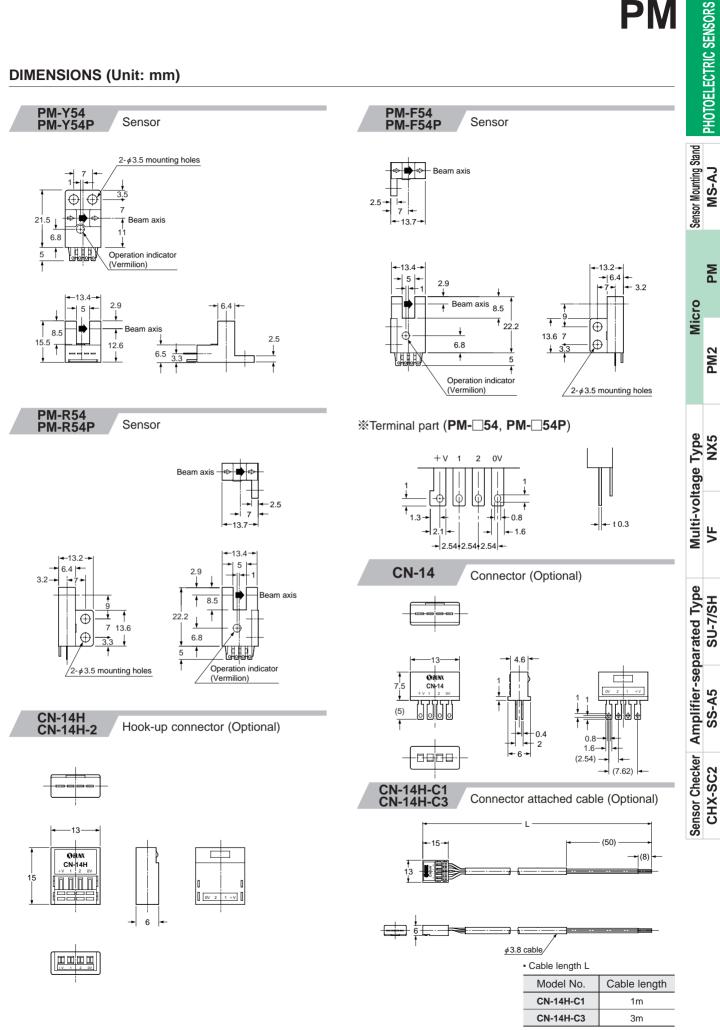

SUNX